



S9850-4C 40G光口1分4 进行链路聚合失败

二层链路聚合

zhiliao_l9hSOv

2023-02-11 发表

组网及说明

设备S9850 版本V7 R 6635

有1个40g 接口（可以1 分4 ），要对接对端设备 4个万兆口。

由于无法接口1对4，故而在S9850 上将接口1分4 口进行链路聚合。

告警信息

Can't assign the port to the aggregation group because its attribute configuration are different than the aggregate interface

问题描述

接口批量无法加入聚合组

```
[H3C]interface range Ten-GigabitEthernet 1/1/5:1 to Ten-GigabitEthernet 1/1/5:4
[H3C-if-range]link
[H3C-if-range]link-a
[H3C-if-range]link-aggregation g
[H3C-if-range]link-aggregation g
[H3C-if-range]link-aggregation g?
^
% Unrecognized command found at '^' position.
[H3C-if-range]poer
[H3C-if-range]po
[H3C-if-range]port link
[H3C-if-range]port link-a
[H3C-if-range]port link-aggregation g
[H3C-if-range]port link-aggregation group 1024
can't assign the port to the aggregation group because its attribute configurations are different than the aggregate interface
can't assign the port to the aggregation group because its attribute configurations are different than the aggregate interface
can't assign the port to the aggregation group because its attribute configurations are different than the aggregate interface
can't assign the port to the aggregation group because its attribute configurations are different than the aggregate interface
```

过程分析

后续发现range 的接口中配置不一致

解决方法

后续直接将物理接口配置清空，聚合口也不进行配置。将接口都加入聚合口后，再在聚合口进行配置，从而将配置下发到物理口上。

