

知

M9000-AI-E系列报Board insertion is not allowed in Slot X

交换网板

李瑞

2023-02-16 发表

组网及说明

不涉及

告警信息

%Feb 15 18:59:05:596 2023 M9K DRV/3/SLOT_NOT_RIGHT: Board insertion is not allowed in Slot 6.

%Feb 15 18:59:14:662 2023 M9K DRV/3/SLOT_NOT_RIGHT: Board insertion is not allowed in Slot 6.

问题描述

开局后一直报如下的错误:

%Feb 15 18:59:05:596 2023 M9K DRV/3/SLOT_NOT_RIGHT: Board insertion is not allowed in Slot 6.

%Feb 15 18:59:14:662 2023 M9K DRV/3/SLOT_NOT_RIGHT: Board insertion is not allowed in Slot 6.

过程分析

M9000-AI-E8的对网板插错槽位会报这个日志（M9000-AI-E8只支持slot6、7槽位插交换网板，其余型号可以参考安装手册），但老版本报的日志中的slot号有问题，新版本日志已经优化了

解决方法

有一块交换网板插错槽位了，插回slot7即可，注意，交换网板需要下电操作

