

知 MSR20路由器无线客户端无法访问同一VLAN内的主机的解决方法

祁威菘 2009-03-26 发表

MSR的无线功能配置完成后，无线用户无法访问同一VLAN内的其他用户，和AP的二层隔离的效果一样。解决方法是开启路由器的二层软转发功能。无线客户端和同一VLAN内其他客户端（包括无线和有线用户）的二层转发都属于这种范畴。

普通的二层转发是由硬件实现的，是有线和有线之间的互通。而二层软转发是指STATION和STATION之间、STATION和PC之间通过设备完成的互通，这种转发是由软件实现的。当STATION和STATION、STATION和PC在同一个VLAN中时，他们之间报文的转发通过二层软转发实现，不需要通过三层转发；而当他们不在一个VLAN中时，就需要通过三层转发实现。

精简配置：

```
#  
l2fw fast-forwarding  
#  
acl number 2000  
rule 0 permit source 192.168.1.0 0.0.0.255  
rule 5 permit source 192.168.2.0 0.0.0.255  
#  
vlan 1  
#  
dhcp server ip-pool aaa  
network 192.168.2.0 mask 255.255.255.0  
gateway-list 192.168.2.1  
dns-list 211.147.6.3 202.106.46.151  
#  
wlan service-template 1 crypto  
ssid test  
cipher-suite wep40  
wep default-key 1 wep40 pass-phrase 12345  
service-template enable  
#  
interface Ethernet0/1  
port link-mode route  
nat outbound 2000  
ip address 101.0.4.120 255.255.0.0  
#  
interface vlan-interface 1  
ip address 192.168.2.1 255.255.255.0  
#  
interface WLAN-BSS 0  
ip address 192.168.2.1 255.255.255.0  
#  
interface WLAN-Radio2/0  
service-template 1 interface WLAN-BSS 0
```