



CAS添加共享存储卷失败之错误码5106


芮恒 2022-01-26 发表

组网及说明

不涉及

问题描述

现场主机可正常识别该FC存储卷，但执行添加时报错配置多路径失败，错误码5106

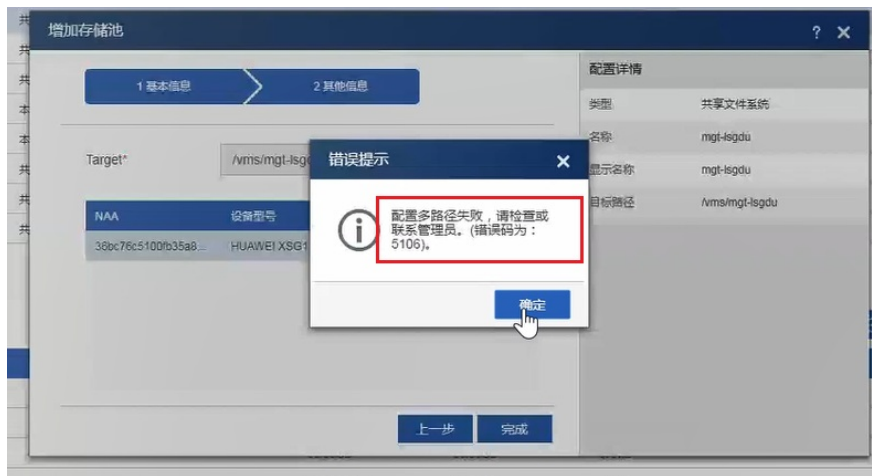

过程分析

1、后台查看syslog系统日志，可以看到LUN信息改变而未自动更新的打印，判断可能和udev未自动更新有关，前后台共享存储卷记录信息不一致会导致配置存储多路径时无法正常识别该存储卷。

```
Jan 25 15:39:55 cvknode049 snmpd[7482]: Connection from UDP: [10.0.255.141]:48830->[10.0.24.49]
Jan 25 15:39:55 cvknode049 snmpd[7482]: Connection from UDP: [10.0.255.141]:48830->[10.0.24.49]
Jan 25 15:40:01 cvknode049 kernel: [19616830,134604] sd 7:0:0:1: Warning! Received an indication that the LUN assignments on this target have changed. The Linux SCSI layer does not automatical
Jan 25 15:40:01 cvknode049 kernel: [19616830,137180] sd 8:0:0:1: Warning! Received an indication that the LUN assignments on this target have changed. The Linux SCSI layer does not automatical
Jan 25 15:40:03 cvknode049 kernel: [19616832,140431] sd 7:0:0:1: Warning! Received an indication that the LUN assignments on this target have changed. The Linux SCSI layer does not automatical
Jan 25 15:40:03 cvknode049 kernel: [19616832,143107] sd 8:0:0:1: Warning! Received an indication that the LUN assignments on this target have changed. The Linux SCSI layer does not automatical
Jan 25 15:40:09 cvknode049 snmpd[7482]: error on subcontainer 'ia_addr' insert (-1)
Jan 25 15:40:23 cvknode049 snmpd[7482]: Connection from UDP: [10.0.255.141]:48830->[10.0.24.49]
```

解决方法

- 1、主机后台执行udevadm trigger更新udev信息
- 2、前台重新启动挂载存储卷

